

PROBLEM	PROBABLE CAUSE	SOLUTION
<p>Misting Flying of ink, mist or fog of ink droplets around the press.</p>	<ol style="list-style-type: none"> 1. Carrying too much ink on rollers. 2. Fountain is feeding too thick an ink film to the fountain roller. 3. Ink is too long and tacky. 4. Worn, cracked or frayed rollers. 5. Improperly set rollers. 6. Not enough sideways motion of the vibrator drums, allowing ink to form ridges on the rollers. This increases its tendency to fly. 	<ol style="list-style-type: none"> 1. Make ink stronger with better transfer to allow less ink to be carried on rollers. 2. Tighten the fountain blade and adjust the ratchet to give the roller more movement. 3. Add shortening material such as Cabosic or talc. 4. Replace damaged rollers. 5. Reset rollers to proper pressure. 6. If possible, increase lateral distribution by increasing the sideways motion of the distributor drum.